



## Oil Cooler Hose Caution on 2015-2017 Ford 5.2L DOHC Engines

The AERA Technical Committee offers the following information on an oil cooler hose caution for 2015-2017 Ford 5.2L DOHC engines. These engines are installed in various Mustang vehicle models.

Ford Motor Company has issued a safety recall to inspect the engine oil cooler tube assembly as some vehicles may have insufficient crimps on the hose that could lead to a hose separation causing an oil leak. If a sufficient amount of oil leaks or there is a sudden loss of engine oil, engine damage will result.

Dealers are to replace all factory installed oil cooler tube assemblies with an improved tube Part #FR3Z-6B850-B. It is advised to check for this updated hose assembly on any applicable Mustang that arrives for service at shops during all future dates.

